

INVOICE

Date: 10/10/2021 **INVOICE #** 419

RK AUTO ELECTRICS

ABN: 76 648 696 879 Ph: 0428 346 202

Att:

Purchase Order No	Purchase Order No Machine		Hours/Kms
	Hino 500 Tilt Tray		289,671 Kms

RTA: AU53107

Qty	Description	Unit Price	Line Total
17	Labour	\$80.00	\$1360.00
1	Parts	\$2189.52	\$2189.52
0.65	Refrigerant (Kg)	\$59.53	\$38.70
	Travel to site and carryout full electrical inspection on truck. Repair taillights not working. Remove dash panels, pillar trim and RH door card. Supply and install UHF and AM/FM radio. Mount and route UHF aerial through RH door and secure to harness. Refit RH door card. Remove main interior light and route handsfree microphone through hood lining and connect. Refit pillar trim. Remove all unused cabling ect from dash. Repair wiring at door switches. Supply and install voltage reducer for radios. Supply and install 2x LED work lights to tray toolboxes and test. Ok. Inspect A/C operation. Found compressor seized and suction hose missing. Remove alternator and intake tubing to access compressor. Supply and install new compressor. Remove desiccant filter from condenser. Flush AC system. Supply and install new suction line, desiccant filter and tx-valve. Clean out condenser and evaporator core. Clear drain tube. Refit intake tubing and alternator. Check drive belt condition and adjust. Ok. Vac and charge system. Test operation. All Ok. Refit dash panels		
		Sub Total	\$3588.22
		GST	\$358.82
		Balance Due	\$3947.04

Direct Payment Details:

Trading Name: RK Auto Electrics Suncorp 484-799 Bank: BSB: 351756907 Account Number:

Please E-Mail proof of payment to:

RKAuto@hotmail.com.au

Unless prior arrangements have been made, this invoice must be paid in full within 30 days.

Thank you for your business!



INVOICE

Date: 24/12/2021 **INVOICE #** 508

RK AUTO ELECTRICS

ABN: 76 648 696 879 Ph: 0428 346 202

Att:

Purchase Order No	Machine	Serial No	Hours/Kms	
	Hino 500 Tilt Tray	XQ-94UN	290,275 Kms	

RTA: AU53107

Qty	Description	Unit Price	Line Total
4.5	Labour	\$80.00	\$360.00
1	Parts	\$249.80	\$249.80
0.65	R134A Refrigerant (Kg)	\$59.53	\$38.70
	Travel to site and inspect air conditioner not working. Check system pressures – low charge. Check over system to find crack in evaporator core. Supply and install new evaporator. Vac and charge. Test operation. All Ok.		
		Sub Total	\$648.50
		GST	\$64.85
		Balance Due	\$713.35

Direct Payment Details:

Trading Name: RK Auto Electrics
Bank: Suncorp
BSB: 484-799
Account Number: 351756907

Please E-Mail proof of payment to:

RKAuto@hotmail.com.au

Unless prior arrangements have been made, this invoice must be paid in full within 30 days.

Thank you for your business!

Connor's Welding Works Pty Ltd

29 - 39 Old Capricorn Highway


Gracemere. Qld. 4702

Ph: 49331181 Fax 49332560

ACN 087 969 051 ABN 87 087 969 051

Tax Invoice

DATE	INVOICE NO
9/09/2021	30653

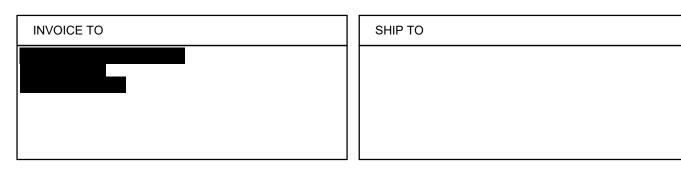

P.O. NO.	TERMS	TRAY No.
	Before delivery	

Hydraulic oil 15 5.70 8.55 8 Replace stainless steel toolbox door 1 528.00 52.80 52 3 x Qld transport mod plates 3 220.00 66.00 66 Freight on ram, 1 way 1 198.00 19.80 19	DESCRIPTION	QTY	RATE	TAX A	AMOUNT
	Remove & refit hydraulic ram on tilt tray, replace rear light channel Hydraulic oil Replace stainless steel toolbox door 3 x Qld transport mod plates Freight on ram, 1 way	1 15 1 3 1	1,660.00 5.70 528.00 220.00 198.00	166.00 8.55 52.80 66.00 19.80	1,660.00 85.50 528.00 660.00 198.00 64.00

Connor's Welding Works Pty Ltd retain title in all goods until paid in full.

Direct Banking Details -BSB 084 901
A/c 47 057 9934
Bank NAB

E-mail address

Connorswelding@bigpond.com

Tax \$319.55

PLEASE NOTE: A Surcharge of 2% will apply when paying account by Credit Card

TOTAL

\$3,515.05

Tax Invoice

Date: Invoice #: 25/10/2021 50749

FLEET SERVICES

Apex Fleet Services Phone 0749288419

Email gina@apexfleetservices.com.au

15 Thozet Road Koongal, QLD 4700 A.B.N. 76 645 877 130

> Registration XQ94UN Make/Model HINO GD Odometer 1

VIN JHDGD8JLKXXX10080

Item	Description	Quantity	Unit Price	GST	Total
PARTS					
K1 Transmitter	TRANSMITTER FOR THE TRAVEAS REQU	1.00	\$690.00	\$69.00	\$759.00
SUPPLY NEW	TRANSMITTER FOR TILT TRAY AS REQU	ESTED.		Parts Total	\$759.00
				Subtotal	\$690.00
				Freight	\$18.00
				GST	\$70.80
				Total	\$778.80
Payment Terms	s: 14DAYS		E	Balance Due	\$778.80

Note that our Banking details are Account Name CC Industries PTY LTD | BSB 064-710 | Account Number 10692873 Please remember to note the INVOICE number on your EFT remittance

Tait Mechanical Pty Ltd 902 Milman Road Wattlebank QLD 4704

Justin: 0429 343 155

Email:

Bill To:



A.B.N. 40 631 661 446

Tax Invoice

Invoice No.: 00000734

Date: 19/09/2022

Customer Purchase Order:

Terms: Strictly 7 Days

DESCRIPTION	AMOUNT	CODE
Model: Hino FC7J Rego: XQ94UN Km's: 219936		
Carry out inspection and supply COI on Hino tilt tray Check improper brake operation, adjust brakes all round	\$270.00	GST

PAYMENT DETAILS

Direct Deposit
Tait Mechanical Pty Ltd

BSB: 633 000

Account: 165 745 621

GST: \$27.00 Total Inc GST: \$297.00 Amount Applied: \$0.00

Balance Due: \$297.00

Tait Mechanical Pty Ltd 902 Milman Road Wattlebank QLD 4704

Justin: 0429 343 155

Email:



A.B.N. 40 631 661 446

Tax Invoice

Invoice No.: 00000542

Date: 7/12/2021

Customer Purchase Order:

Terms: Strictly 7 Days

Bill To:		

DESCRIPTION	AMOUNT	CODE
Model: Hino GD Rego: XQ94UN Km's: 290032		
Rectify oil leaks from engine Remove intake piping and rocker cover	\$1,615.00	GST
Disassemble over head rocker gear and camshaft		
Remove all injector lines and injectors Remove camshaft housing from cylinder head		
Clean all parts, replace gasket and reassemble Refit all injectors and rocker gear		
Adjust all valve clearances to spec		
Replace seals and gaskets, replace upper rocker cover Remove inter cooler and clean		
Remove and replace perished radiator Reassemble inter cooler housing		
Tested and re used coolant		
Parts - 1x radiator assy, 1x camshaft housing gaskets, rocker cover gaskets, plugs and o'rings	\$1,549.90	GST
Consumables	\$25.00	GST

PAYMENT DETAILS

Direct Deposit
Tait Mechanical Pty Ltd

BSB: 633 000

Account: 165 745 621

GST: \$318.99
Total Inc GST: \$3,508.89
Amount Applied: \$0.00

Balance Due: \$3,508.89

Tait Mechanical Pty Ltd 902 Milman Road Wattlebank QLD 4704

Justin: 0429 343 155

Email:

Bill To:



A.B.N. 40 631 661 446

Tax Invoice

Invoice No.: 00000496

> Date: 5/10/2021

Customer Purchase Order:

Strictly 7 Days Terms:

CAU.
PTYLTD

DESCRIPTION	AMOUNT	CODE
Model: Hino GDIJ Unreg Km's: 289671		
Carry out inspection and supply COI on Hino Tilt tray	\$140.00	GST
Carry out measure up and compliance inspection for new registration	\$80.00	GST
Model: Kenworth T403 Rego: 781WGT Km's: 58246		
Carry out pre TMR inspection check over Raise all axles, adjust brakes, check wheel bearings, grease vehicle Connect to ECM, check and clear fault codes	\$285.00	GST

PAYMENT DETAILS

Direct Deposit Tait Mechanical Pty Ltd

BSB: 633 000

Account: 165 745 621

GST: \$50.50 Total Inc GST: \$555.50 Amount Applied: \$0.00

Balance Due: \$555.50